

ZIEHL industrie - elektronik GmbH + Co KG Daimlerstr.13, 74523 Schwäbisch Hall, Germany + 49 791 504-0, info@ziehl.de, www.ziehl.de

Temperature Relays and MINIKA® Mains Monitoring Digital Panelmeters MINIPAN®

Switching Relays and Controls

Measuring Transducers

Grid- and Plant Protection

Operating Manual MU1001K

updated: 2023-09-26 / dr from Firmware: 0-04



For more information and help about this product please scan the QR-Code or choose the following link: MU1001K

Operating manual, Quick guide, Datasheet, Connection diagram, CAD Data Firmwareupdates, FAQ, Videos about installation and settings, Certificates

- Universal-Measuring-Transducer











Table of contents

1	Gene	ral Notes	2
2	Appli	cation and short description	2
3	Overv	view of functions	3
4	Conn	ecting diagram	3
5	Impo	rtant Information	4
6	Instal	lation	5
7	Comr	missioning	6
	7.1	Overview of commissioning	6
	7.2	Overview of the predefined standard ranges	6
	7.3	Setting a predefined range	7
	7.4	Diagram for setting a predefined range	8
	7.5	Overview of scaling an arbitrary range	9
	7.6	Scaling of range	9
	7.7	Diagram for scaling of range	10
	7.8	Factory setting	111
	7.9	Query of firmware-version	11
	7.9	.1 Revision Firmware	111
8	Error	search	111
9	Techi	nical data	111
10	Hous	ing Type K	133
11	Dispo	osal	13

1 General Notes

Compliance with the following instructions is mandatory to ensure the functionality and safety of the product. If the following instructions given especially but not limited for general safety, transport, storage, mounting, operating conditions, commissioning and disposal / recycling are not observed, the product may not operate safely and may cause a hazard to the life and limb of users and third parties.

Deviations from the following requirements may therefore lead both to the loss of the statutory material defect liability rights and to the liability of the buyer for the product that has become unsafe due to the deviation from the specifications.

2 Application and short description

Universal Measuring-Transducers MU1001K can measure DC-signals up to 300 V.

Pre-set measuring-ranges can be selected by the user.

More measuring-ranges (zero and full scale) can be easily scaled.

The output-signals DC 0/2-10 V and 0/4-20 mA are insulated from measuring-input and supply-voltage.


With its universal power-supply AC/DC 24-240 V the measuring-transducer can be connected to all common supply-voltages.



Overview of functions

- Current input 0-20mA, scalable
- Voltage input 0-10V, scalable
- Input Pt 100, 3-wire, -200...+800 °C, scalable
- Output signal 0-20mA and 0-10V or 4-20mA and 2-10V
- Rated Supply Voltage AC/DC 24-240V
- Insulation between inputs, outputs and supply voltage
- Standard ranges adjustable, universally scalable input ranges

Connecting diagram

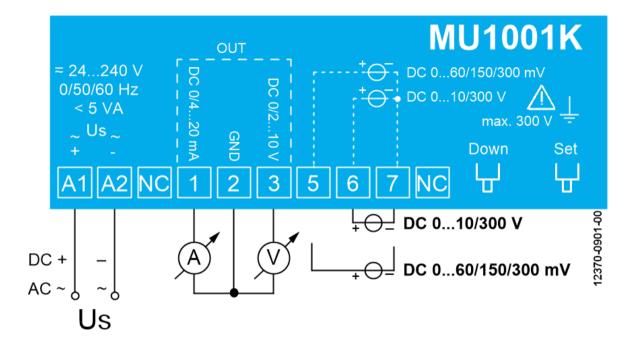



Important Information



DANGER!

Hazardous voltage!

Will cause death or serious injury. Turn off and lock out all power supplying this device before working on this device.



Attention!

The measuring input fulfils reinforced insulation according to DIN EN 61010-1 for overvoltage category II, measuring category II and pollution degree 2. Connected voltages may not exceed 300 V AC/DC to earth.

To use the equipment flawless and safe, transport and store properly, install and start professionally and operate as directed.

Only let persons work with the equipment who are familiar with installation, start and use and who have appropriate qualification corresponding to their function. They must observe the contents of the instructions manual, the information which are written on the equipment and the relevant security instructions for the setting up and the use of electrical units.

The equipment is built according to DIN VDE/EN/IEC and checked and leave the plant according to security in perfect condition. If, in any case the information in the instructions manual is not sufficient, please contact our company or the responsible representative.

In order to maintain this status, you must observe the safety regulations entitled "caution" in this operating manual. Failures to follow the safety regulations can result in death, personal injury or property damage to the device itself and to other devices and facilities.

To maintain this condition, you must observe the safety instructions in this instruction manual titled "Important Information". Failure to follow the safety instructions may result in death, personal injury, or property damage to the equipment itself and other equipment and facilities.

Instead of the industrial norms and regulations written in this instruction manual valid for Europe, you must observe out of their geographical scope the valid and relevant regulations of the corresponding country.



Attention!

Only one of the two measuring inputs terminals 5+7 or terminals 6+7 may be used.



www.ziehl.de

MU1001K 12370-0707-03 Page 4 / 13

6 Installation

The unit can be installed as follows:

- Installation in switchgear cabinet on 35 mm mounting rail according to EN 60715 for protection against fire, external environmental conditions and mechanical effects.
- With screws M4 for installation on walls or panel. (additional latch is not included in delivery)
- Connection according to connection plan or type plate.

Failure to comply with the information in this instruction manual will not guarantee the function of the device.



Attention!

A circuit-breaker or switch must be situated within easy reach of the unit and fused. Installation excess current protection should be \leq 10 A.



Attention! Universal power supply

The device has a universal power supply, that is suitable for DC- and AC-voltages. Before connecting the device to supply-voltage make sure that the connected voltage corresponds with the voltage on the lateral type on the device



Attention!

Observe the maximum temperature permissible when installing in switching cabinet. Make sure sufficient space to other equipment or heat sources. If the cooling becomes more difficult e.g. through close proximity of apparatus with elevated surface temperature or hindrance of the cooling air, the tolerable environmental temperature is diminishing.



Attention!

All wires connected to the device must have insulation rated at least 300 Vac.



www.ziehl.de

MU1001K 12370-0707-03 Page 5 / 13

7 Commissioning

7.1 Overview of commissioning

The MU1001K can be commissioned to predefined standard ranges or scaled to an arbitrary range. There are two different ways to do the settings:

Point 6.2 – 6.4: MU1001K setting a predefined range Point 6.5 – 6.7: MU1001K scaling an arbitrary range

7.2 Overview of the predefined standard ranges

Following standard ranges can be set without adjustment to the unit:

Input (300 V)				
Zero point	Full scale			
0 V	20 V			
0 V	50 V			
0 V	100 V			
0 V	200 V			
0 V	300 V			

Input (10 V)			
Zero point	Full scale		
0 V	10 V		
2 V	10 V		
-10 V	10 V		

Input (mV)			
Zero point	Full scale		
0 mV	60 mV		
0 mV	150 mV		
0 mV	300 mV		
-60 mV	60 mV		
-150 mV	150 mV		
-300 mV	300 mV		



www.ziehl.de MU1001K 12370-0707-03 Page 6 / 13

7.3 Setting a predefined range

Power off the device						
Press Button [Set] and keep pressed						
Power on the device, and keep pressed	Power on the device, and keep pressed the button [Set]					
After 5s flashes the green LED, releas	se button [Set]					
Parameterization "input type" >> LED	ON flashes 1x					
Select with button [Set] the input type (displayed by LE	EDs 300 V / 1	0 V / mV)			
Press button [Down]						
Parameterization "range" >> LED ON	flashes 2x					
	Number of		LED			
Select with button [Set] the range of	flashes	300 V	10 V	mV		
the input	1 x	0 - 20 V	0 - 10 V	0 - 60 mV		
	2 x	0 - 50 V	2 - 10 V	0 - 150 mV		
	3 x	0 - 100 V	-1010 V	0 300 mV		
	4 x	0 - 200 V		-6060 mV		
	5 x	0 - 300 V		-150150 mV		
				-300300mV		
Press button [Down]						
Parameterization "output" >> LED Pov	wer flashes 4x					
	Number o	of	LED			
Select with button [Set] the output range	e flashes	10	10 V + mV			
	1 x	0 - 10	V / 0 - 20mA			
2 x 2 - 10V / 4 - 20mA						
Press button [Down]						
End of parameterization, LED ON lights permanently						


Attention:

- When no button is pressed during scaling for 120 s, the process is cancelled automatically. Entered values will be discarded.
- When scaling is started, all parameters are reset to default. Parameters cannot be checked after scaling has been finished.
- In normal operating mode the selected input is displayed with LED.



MU1001K 12370-0707-03 Page 7 / 13

7.4 Diagram for setting a predefined range

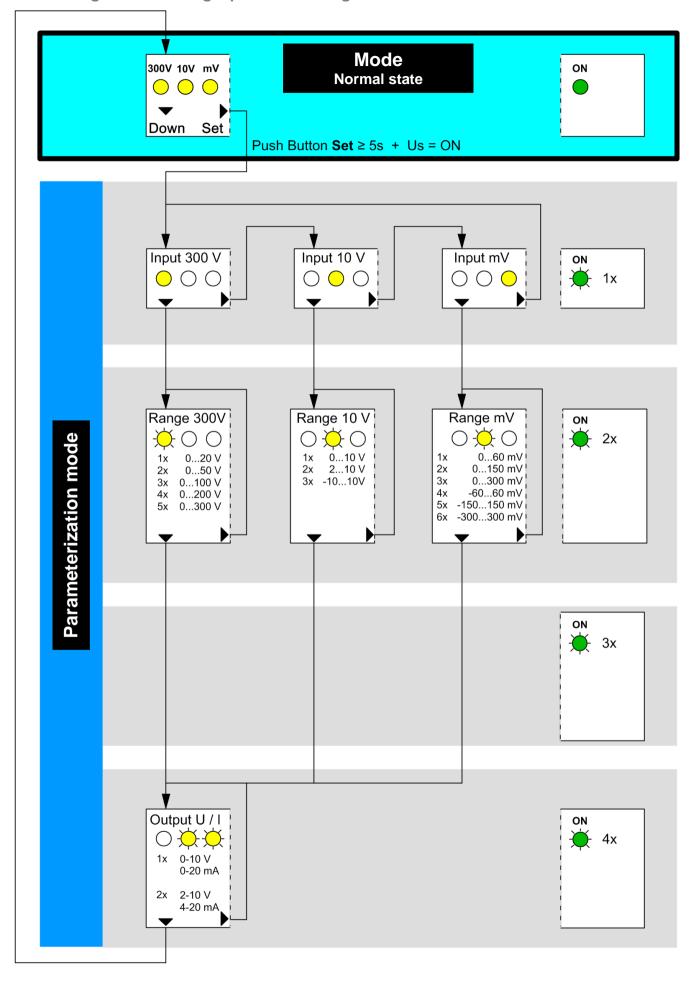

ZIEHL

7.5 Overview of scaling an arbitrary range

Other ranges may be set by scaling of the input signal:

	range		
Input	Zero point	Full scale	
300 V	0 300 V	0 300 V	
10 V	-10 10 V	-10 10 V	
mV (300 mV)	-300 300 mV	-300 300 mV	

Output		
0 - 10 V / 0 - 20 mA		
oder		
2 - 10 V / 4 - 20 mA		

7.6 Scaling of range

Parameterization:

Power off the device				
Press Button [Down] and keep pressed				
Power on the device, and keep pressed the	ne button [Dow	n]		
After 5s flashes the green LED, release b	outton [Down]			
Parameterization "input type" >> LED Po	wer flashes 1x			
Select with button [Set] the input type (disp	played by LEDs	s 300 V / 10 V / mV)		
Press button [Down]				
Parameterization "input zero point" >> LE	ED Power flash	es 2x		
Connect a signal at the input correspond	ing to the zero	point		
Press button [Down] (store of value, green LED flashes 3 times quickly)				
Parameterization "input full scale" >> LED Power flashes 3x				
Connect a signal at the input corresponding to the full scale				
Press button [Down] (store of value, green LED flashes 3 times quickly)				
Parameterization "output" >> LED Power	Parameterization "output" >> LED Power flashes 4x			
	Number of	LED		
Select with button [Set] the output range	flashes	10 V / mV		
	1 x	0 - 10V / 0 - 20mA		
	2 x	2 - 10V / 4 - 20mA		
Press button [Down]				
End of parameterization, Power LED lights permanently				

Attention:


- When no button is pressed during scaling for 120 s, the process is cancelled automatically. Entered values will be discarded.
- When scaling is started, all parameters are reset to default. Parameters cannot be checked after scaling has been finished.
- In normal operating mode the selected input is displayed with LED.



www.ziehl.de

MU1001K 12370-0707-03 Page 9 / 13

7.7 Diagram for scaling of range

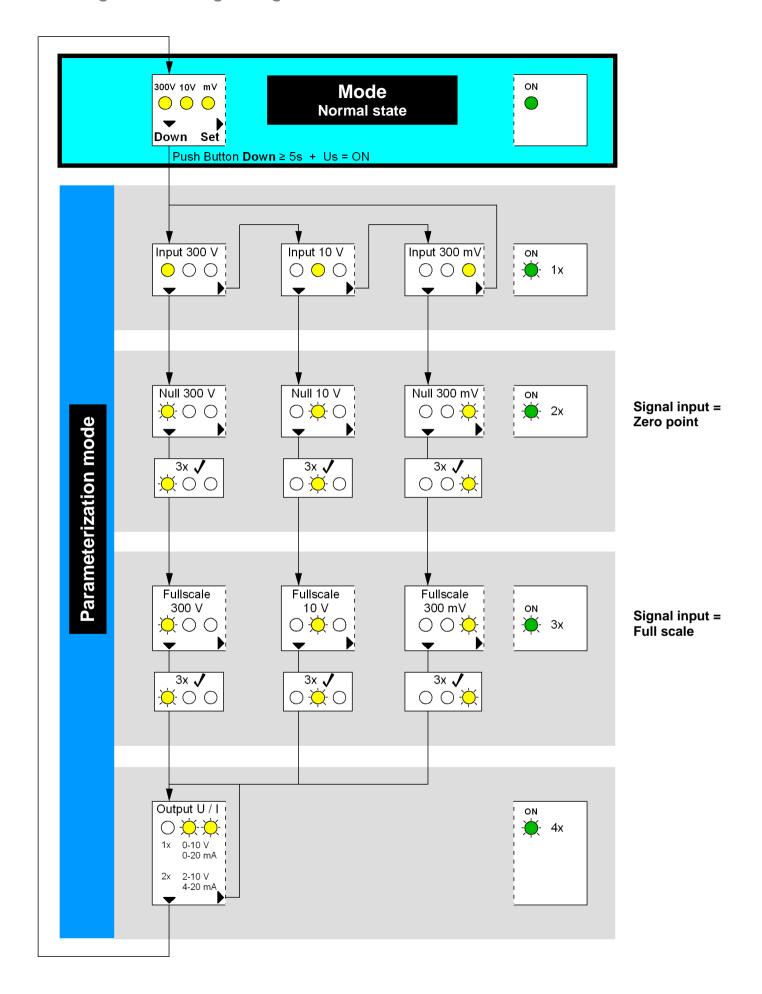

ZIEHL

7.8 Factory setting

Default settings:

Input: $[10 \text{ V}] \rightarrow DC 0 - 10 \text{ V}$ Output: 0 - 10 V, 0 - 20 mA

7.9 Query of firmware-version

from firmware 0-04:

- Keep [Set] button pressed (≥ 5s)
 - ⇒ LEDs indicate the firmware version by fast blinking (binary coded, LED 300V = bit0 ... LED ON = bit3)

LED	300 V	10 V	mV	ON
Bit No. (value)	0 (1)	1 (2)	2 (4)	3 (8)
example (LED)	off	off	flash	off

→ Version 0-04

7.9.1 Revision Firmware

Version 0-04:

additional predefined standard ranges (-10...10V, -60...60mV, -150...150mV, -300...300mV)

8 Error search

Wrong outp	Wrong output signal (current/voltage) OUT (terminal 1 – 2 – 3)		
Cause	The device is not configured correctly		
Remedy	Check commissioning		

For selected output range 4-20 mA (2-10V) the current is < 3,8 mA (the voltage is <1,9V)				
Cause	Cause Sensor short-circuit or sensor interruption			
Remedy	Check sensor/wire at terminal 5-6-7			

9 Technical data


Rated supply voltage Us	AC/DC 24 – 240 V	0/50/60Hz
Tolerance	DC 20,4 - 297 V	AC 20 - 264 V
Power consumption	< 3 W	< 8 VA

Input	Input- resistance	Maximum Input signal	Error of full scale
DC 300 V	500 kΩ	DC ± 300 V	0,1 %
DC 10 V	500 kΩ	DC ± 300 V	0,1 %
DC 60mV max. 300 V	10 ΜΩ	DC ± 2 V	0,1 %
DC 150mV	10 ΜΩ	DC ± 2 V	0,1 %
DC 300mV	10 ΜΩ	DC ± 2 V	0,1 %

Resolution 14 Bit Measuring time < 20 ms

MU1001K 12370-0707-03 Page 11 / 13 www.ziehl.de

2 outputs with common ground Output Response-time T09 < 40 ms Voltage output DC 0/2 - 10 V Tolerance 0,3 % of full scale (from 0,1 V) Temperature factor < 0.01 % / K Resolution 11.6 Bit $< 3.1 \, \text{mV}$ Load ≥ 1 k Ω Current output DC 0/4 - 20 mA**Tolerance** 0,3 % of full scale (from 0,1 mA) Temperature factor < 0.015 % / K Resolution 11,6 Bit $< 6,1 \mu A$ ≤ 500 Ω Load $(250 \Omega - resistance) / 250 \Omega * 0.3 \%$ of final value Error from load Galvanic insulation Us - input - output Test voltage Us – output DC 3540V Us - input DC 3540V Input – output DC 3540V Test conditions EN 61010-1 Rated supply voltage Us (terminals A1,A2) Pollution degree 2 III reinforced insulation Overvoltage category 300 V Rated insulation voltage Ui Input (terminals 5,6,7) Pollution degree Overvoltage category II reinforced insulation 300 V Rated insulation voltage Ui **EMC-tests** EN 61326-1 Equipment intended for use in industrial locations Emission EN 61326-1, CISPR 11 class B **Immunity** EN 61326-1 industrial environment Electrical fast transient (Burst) EN 61000-4-4 ±4,5 kV Pulse 5/50 ns, f = 5 kHz, t = 15 ms, T = 300 ms Surge immunity test IEC 61000-4-5 ±2 kV Environmental conditions Permissible ambient temperature -20 °C ... +65 °C -20 °C ... +70 °C Permissible storage temperature -5 °C ... +70 °C Permissible wiring temperature Climatic conditions 5 – 85 % rel. humidity, no condensation Installation height < 2000 m Vibration resistance EN 60068-2-6 2...25 Hz ±1,6 mm 25 ... 150 Hz 5 g

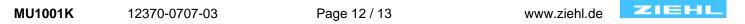


Hous	sing	Type K
	Dimension (H x W x D)	75 x 22,5 x 115 mm
	Width Line connection solid wire	1 TE each 1 x 0,52,5 mm ²
	Stranded wire with insulated ferrules	each 1 x 0,141,5 mm ²
	Torque	0.5 Nm (3,6 lb.in)
	Protection class housing / terminals	IP 40 / IP 20
	Mounting	Snap mounting on 35 mm standard rail EN 60 715 or M4 screws
	Weight	app. 100 g

Subject to technical changes

10 Housing Type K

Dimensions in mm

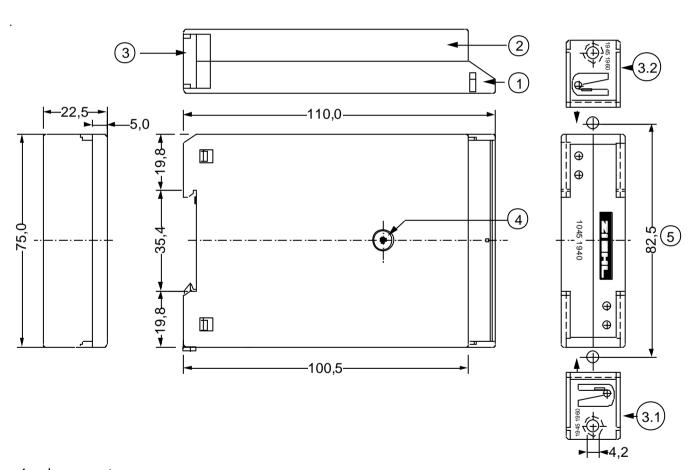

- 1 lower part
- 2 3 upper part
- 4 screw
- holes for screw-mount

11 Disposal



Disposal should be carried out properly and in an environmentally friendly manner in accordance with legal provisions.

ZIEHL is registered with the EAR Foundation under WEEE no.: DE 49 698 543.

